

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start		Rating **	M	Issue No.	18
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_RD0765_01_s _ 2013_18				
Action/Comments					
Inspector Comments: The LMA does have an adequate supply of flood fight materials.					

No Photos

LM Start		Rating **	A	Issue No.	44
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_RD0765_01_s _ 2012_44				
Action/Comments					
Inspector Comments: LMA has a copy of O&M manual on file in office.					

No Photos

LM Start		Rating **	M	Issue No.	46
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			°	°
				°	°
DWR ID	DWR_RD0765_01_s _ 2012_46				
Action/Comments					
Inspector Comments: LMA does not have a written flood preparedness plan. Also LMA staff has not been involved in flood training for several years.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.04	Rating **	U	Issue No.	39
LM End	1.16	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.502458 °	38.487303 °
				-121.560170 °	-121.553918 °
DWR ID	DWR_RD0765_01_s _ 2015_39				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

No Photos

LM Start	0.05	Rating **	M	Issue No.	3
LM End	0.05	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.502253 °	38.502253 °
				-121.560192 °	-121.560192 °
DWR ID	DWR_RD0765_01_s _ 2012_3				
Action/Comments					
Trim trees to at least five feet above ground level.					

Photo 1 of 1 : SP_2015_RD0765_211_3_20150309_00003.jpg



Looking north (upstream) at trees on landside slope.

LM Start	0.09	Rating **	A/W	Issue No.	27
LM End	0.09	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.501650 °	38.501650 °
				-121.560290 °	-121.560290 °
DWR ID	DWR_RD0765_01_s _ 2012_27				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.12	Rating **	M	Issue No.	28
LM End	0.19	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.501215 °	38.500271 °
				-121.560432 °	-121.560434 °
DWR ID	DWR_RD0765_01_s_2012_28				
Action/Comments					
Trim and thin trees to allow visibility of the ground and room to flood fight.					

Photo 1 of 2 : SP_2015_RD0765_211_28_20150309_00028.jpg



Looking downstream (south) at trees on landside slope & toe.

LM Start	0.12	Rating **	M	Issue No.	28 (cont)
LM End	0.19	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : SP_2015_RD0765_211_28_20150309_00029.jpg



Looking west at trees on landside toe.

LM Start	0.13	Rating **	M	Issue No.	45
LM End	0.13	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.501181 °	38.501181 °
				-121.560410 °	-121.560410 °
DWR ID	DWR_RD0765_01_f_2013_45				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.14	Rating **	M	Issue No.	22
LM End	0.14	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.500928 °	38.500928 °
				-121.560431 °	-121.560431 °
DWR ID	DWR_RD0765_01_s _ 2012_22				
Action/Comments					
Elderberries are blocking visibility and flood fight capability.					

Photo 1 of 1 : SP_2015_RD0765_211_22_20150309_00025.jpg



Looking northwest at dense vegetation on landside slope.

LM Start	0.18	Rating **	A/W	Issue No.	14
LM End	0.34	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.500343 °	38.498032 °
				-121.560507 °	-121.560337 °
DWR ID	DWR_RD0765_01_s _ 2012_14				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	0.21	Rating **	A/W	Issue No.	25
LM End	0.21	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.500018 °	38.500018 °
				-121.560457 °	-121.560457 °
DWR ID	DWR_RD0765_01_s _ 2012_25				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.24	Rating **	M	Issue No.	49
LM End	0.24	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.499530 °	38.499530 °
				-121.560490 °	-121.560490 °
DWR ID	DWR_RD0765_01_s _ 2013_49				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Wild berryvines on landside slope.					

Photo 1 of 1 : SP_2015_RD0765_211_49_20150309_00050.jpg



Looking at wild berryvines or wild roses on landside slope and toe.

LM Start	0.25	Rating **	A/W	Issue No.	11
LM End	0.27	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.499405 °	38.499042 °
				-121.560445 °	-121.560430 °
DWR ID	DWR_RD0765_01_s _ 2012_11				
Action/Comments					
Thin trees to allow visibility of the ground and room to flood fight.					

Photo 1 of 5 : SP_2015_RD0765_211_11_20150309_00011.jpg



Looking northeast at overgrown trees on waterside slope.

LM Start	0.25	Rating **	A/W	Issue No.	11 (cont)
LM End	0.27	Issue Type +	Ma	Location *	WS

Photo 2 of 5 : SP_2015_RD0765_211_11_20150309_00012.jpg



Looking north at dense trees on waterside slope from fall 2010 inspection.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.25	Rating **	A/W	Issue No.	11 (cont)
LM End	0.27	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.499405 °	38.499042 °
				-121.560445 °	-121.560430 °
DWR ID	DWR_RD0765_01_s_2012_11				
Action/Comments					
Thin trees to allow visibility of the ground and room to flood fight.					

Photo 3 of 5 : SP_2015_RD0765_211_11_20150309_00013.jpg



Looking south (downstream) at dense trees on landside slope and shoulder. (Spring 2013)

LM Start	0.25	Rating **	A/W	Issue No.	11 (cont)
LM End	0.27	Issue Type +	Ma	Location *	WS

Photo 4 of 5 : SP_2015_RD0765_211_11_20150309_00014.jpg



Looking north (upstream) at dense trees on landside slope and shoulder. (Spring 2013)

LM Start	0.25	Rating **	A/W	Issue No.	11 (cont)
LM End	0.27	Issue Type +	Ma	Location *	WS

Photo 5 of 5 : SP_2015_RD0765_211_11_20150309_00015.jpg



Looking upstream (north) at dense vegetation and trees from 2011 spring inspection.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.31	Rating **	A/W	Issue No.	31
LM End	0.31	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.498516 °	38.498516 °
				-121.560463 °	-121.560463 °
DWR ID	DWR_RD0765_01_f_2012_31				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Wild berryvines on landside toe.					

No Photos

LM Start	0.31	Rating **	A/W	Issue No.	23
LM End	0.31	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.498453 °	38.498453 °
				-121.560360 °	-121.560360 °
DWR ID	DWR_RD0765_01_s_2012_23				
Action/Comments					
Thin trees to allow visibility of the ground and room to flood fight.					

Photo 1 of 1 : SP_2015_RD0765_211_23_20150309_00026.jpg



Looking north (upstream) at untrimmed trees on waterside shoulder and slope.

LM Start	0.40	Rating **	A/W	Issue No.	21
LM End	0.40	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.497196 °	38.497196 °
				-121.560147 °	-121.560147 °
DWR ID	DWR_RD0765_01_s_2012_21				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.41	Rating **	A/W	Issue No.	24
LM End	0.52	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.497125 °	38.495648 °
				-121.560087 °	-121.559391 °
DWR ID	DWR_RD0765_01_s_2012_24				
Action/Comments					
Thin trees to allow visibility of the ground and room to flood fight.					

Photo 1 of 1 : SP_2015_RD0765_211_24_20150309_00027.jpg



Looking north (upstream) at untrimmed trees on waterward slope.

LM Start	0.41	Rating **	U	Issue No.	47
LM End	0.41	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.497069 °	38.497069 °
				-121.560106 °	-121.560106 °
DWR ID	DWR_RD0765_01_f_2012_47				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Wild berryvines on landside toe.					

Photo 1 of 1 : SP_2015_RD0765_211_47_20150309_00048.jpg



Looking west at dense berryvines on landside toe.

LM Start	0.43	Rating **	M	Issue No.	32
LM End	0.46	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.496792 °	38.496321 °
				-121.560026 °	-121.559842 °
DWR ID	DWR_RD0765_01_s_2012_32				
Action/Comments					
Trim and thin trees to allow visibility of the ground and room to flood fight.					

Photo 1 of 1 : SP_2015_RD0765_211_32_20150309_00036.jpg



Looking southwest at dense vegetation on landside slope and toe.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.47	Rating **	A/W	Issue No.	55
LM End	0.47	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.496235 °	38.496235 °
				-121.559796 °	-121.559796 °
DWR ID	DWR_RD0765_01_f_2013_55				
Action/Comments					
Garbage					
Inspector Comments: Trash dumped on landside slope.					

Photo 1 of 2 : SP_2015_RD0765_211_55_20150309_00057.jpg



Looking northwest at garbage on landside slope.

LM Start	0.47	Rating **	A/W	Issue No.	55 (cont)
LM End	0.47	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : SP_2015_RD0765_211_55_20150309_00058.jpg



Looking west at garbage on landside slope.

LM Start	0.47	Rating **	M	Issue No.	33
LM End	0.50	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.496217 °	38.495855 °
				-121.559788 °	-121.559586 °
DWR ID	DWR_RD0765_01_s_2012_33				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: District removed some of the wild growth on landside slope and toe.					

Photo 1 of 5 : SP_2015_RD0765_211_33_20150309_00037.jpg



Looking northwest at trees on landside toe from 2010 fall inspection.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.47	Rating **	M	Issue No.	33 (cont)
LM End	0.50	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.496217 °	38.495855 °
				-121.559788 °	-121.559586 °
DWR ID	DWR_RD0765_01_s_2012_33				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: District removed some of the wild growth on landside slope and toe.					

Photo 2 of 5 : SP_2015_RD0765_211_33_20150309_00038.jpg



Looking downstream (south) at trees on landside slope & toe.

Photo 3 of 5 : SP_2015_RD0765_211_33_20150309_00039.jpg



Looking southwest at dense vegetation on landside slope and toe.

Photo 4 of 5 : SP_2015_RD0765_211_33_20150309_00040.jpg



Looking upstream (northwest) at dense vegetation on landside slope.

LM Start	0.47	Rating **	M	Issue No.	33 (cont)
LM End	0.50	Issue Type +	Ma	Location *	LS

LM Start	0.47	Rating **	M	Issue No.	33 (cont)
LM End	0.50	Issue Type +	Ma	Location *	LS

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.47	Rating **	M	Issue No.	33 (cont)	
LM End	0.50	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Vegetation			38.496217 °	38.495855 °	
				-121.559788 °	-121.559586 °	
DWR ID	DWR_RD0765_01_s _ 2012_33					
Action/Comments						
Remove the wild growth other than native grasses from the levee slopes.						
Inspector Comments: District removed some of the wild growth on landside slope and toe.						

Photo 5 of 5 : SP_2015_RD0765_211_33_20150309_00041.jpg



Looking downstream (southwest) at dense vegetation on landside slope.

LM Start	0.54	Rating **	A/W	Issue No.	34
LM End	0.63	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.495347 °	38.494204 °
				-121.559291 °	-121.558313 °
DWR ID	DWR_RD0765_01_s _ 2012_34				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	0.56	Rating **	A/W	Issue No.	10
LM End	0.59	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.495035 °	38.494642 °
				-121.559027 °	-121.558697 °
DWR ID	DWR_RD0765_01_s _ 2012_10				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.63	Rating **	A/W	Issue No.	15
LM End	0.70	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.494171 °	38.493392 °
				-121.558253 °	-121.557640 °
DWR ID	DWR_RD0765_01_s _ 2012_15				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	0.68	Rating **	A/W	Issue No.	35
LM End	0.72	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.493596 °	38.493077 °
				-121.557832 °	-121.557451 °
DWR ID	DWR_RD0765_01_s _ 2012_35				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	0.75	Rating **	M	Issue No.	50
LM End	0.79	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.492713 °	38.492176 °
				-121.557224 °	-121.556893 °
DWR ID	DWR_RD0765_01_s _ 2013_50				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					

Photo 1 of 1 : SP_2015_RD0765_211_50_20150309_00051.jpg



Looking northwest at vegetation on landside slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.77	Rating **	A/W	Issue No.	36
LM End	0.80	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.492392 °	38.492034 °
				-121.557026 °	-121.556820 °
DWR ID	DWR_RD0765_01_s _ 2012_36				
Action/Comments					
Trim and thin trees to allow visibility of the ground and room to flood fight.					

No Photos

LM Start	0.86	Rating **	A/W	Issue No.	17
LM End	0.98	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.491283 °	38.489771 °
				-121.556360 °	-121.555451 °
DWR ID	DWR_RD0765_01_s _ 2012_17				
Action/Comments					
Trim trees to at least five feet above ground level.					

Photo 1 of 6 : SP_2015_RD0765_211_17_20150309_00019.jpg



Looking downstream (south) at dense trees on landside slope and toe.

LM Start	0.86	Rating **	A/W	Issue No.	17 (cont)
LM End	0.98	Issue Type +	Ma	Location *	LS

Photo 2 of 6 : SP_2015_RD0765_211_17_20150309_00020.jpg



Looking upstream (north) at dense trees on landside slope and toe.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.86	Rating **	A/W	Issue No.	17 (cont)	
LM End	0.98	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Trim / Thin Trees			38.491283 °		38.489771 °
				-121.556360 °		-121.555451 °
DWR ID	DWR_RD0765_01_s_2012_17					
Action/Comments						
Trim trees to at least five feet above ground level.						

Photo 3 of 6 : SP_2015_RD0765_211_17_20150309_00021.jpg



Looking south at trimmed trees and vegetation on landside slope and toe.

LM Start	0.86	Rating **	A/W	Issue No.	17 (cont)
LM End	0.98	Issue Type +	Ma	Location *	LS

Photo 4 of 6 : SP_2015_RD0765_211_17_20150309_00022.jpg



Looking southwest at dense trees on landside slope and toe spring 2012.

LM Start	0.86	Rating **	A/W	Issue No.	17 (cont)
LM End	0.98	Issue Type +	Ma	Location *	LS

Photo 5 of 6 : SP_2015_RD0765_211_17_20150309_00023.jpg



Looking southwest at dense vegetation on landward slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.86	Rating **	A/W	Issue No.	17 (cont)	
LM End	0.98	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Trim / Thin Trees			38.491283 °		38.489771 °
				-121.556360 °		-121.555451 °
DWR ID	DWR_RD0765_01_s_2012_17					
Action/Comments						
Trim trees to at least five feet above ground level.						

Photo 6 of 6 : SP_2015_RD0765_211_17_20150309_00024.jpg



Looking south at dense trees on landside shoulder and slope.
(November 2011)

LM Start	0.96	Rating **	M	Issue No.	81
LM End	0.96	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.489962 °	38.489962 °
				-121.555573 °	-121.555573 °
DWR ID	DWR_RD0765_01_s_2012_81				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Dense berryvines on landside slope.					

Photo 1 of 5 : SP_2015_RD0765_211_81_20150309_00064.jpg



Looking west at dense berryvines and wildroses on landside shoulder and slope. (November 2011)

LM Start	0.96	Rating **	M	Issue No.	81 (cont)
LM End	0.96	Issue Type +	Ma	Location *	LS

Photo 2 of 5 : SP_2015_RD0765_211_81_20150309_00065.jpg



Looking northwest at vines on landside toe spring 2012.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.96	Rating **	M	Issue No.	81 (cont)
LM End	0.96	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.489962 °	38.489962 °
				-121.555573 °	-121.555573 °
DWR ID	DWR_RD0765_01_s_2012_81				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Dense berryvines on landside slope.					

Photo 3 of 5 : SP_2015_RD0765_211_81_20150309_00066.jpg



Looking northwest at trimmed trees and vegetation on landside slope and toe.

LM Start	0.96	Rating **	M	Issue No.	81 (cont)
LM End	0.96	Issue Type +	Ma	Location *	LS

Photo 4 of 5 : SP_2015_RD0765_211_81_20150309_00067.jpg



Looking southwest at trimmed trees and vegetation on landside slope and toe.

LM Start	0.96	Rating **	M	Issue No.	81 (cont)
LM End	0.96	Issue Type +	Ma	Location *	LS

Photo 5 of 5 : SP_2015_RD0765_211_81_20150309_00068.jpg



Looking west at trimmed trees on landward slope.

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
N/A : Not Applicable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	0.98	Rating **	A/W	Issue No.	6
LM End	1.14	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.489664 °	38.487617 °
				-121.555370 °	-121.554200 °
DWR ID	DWR_RD0765_01_f_2012_6				
Action/Comments					
Trim trees to at least five feet above ground level.					


Photo 1 of 2 : SP_2015_RD0765_211_6_20150309_00007.jpg



Looking south (downstream) at untrimmed trees on waterward slope.

LM Start	0.98	Rating **	A/W	Issue No.	6 (cont)
LM End	1.14	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : SP_2015_RD0765_211_6_20150309_00008.jpg

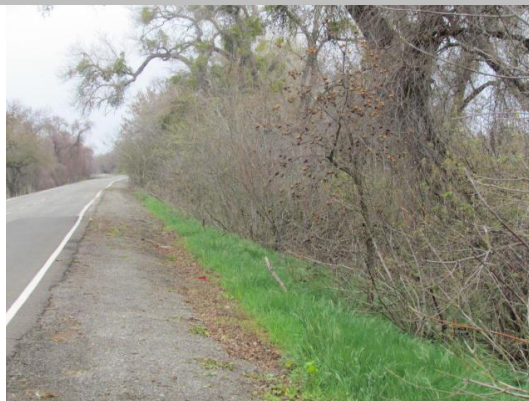

Looking north (upstream) at untrimmed trees on waterward slope.

LM Start	1.01	Rating **	A/W	Issue No.	40
LM End	1.01	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.489283 °	38.489283 °
				-121.555223 °	-121.555223 °
DWR ID	DWR_RD0765_01_s_2012_40				
Action/Comments					
Trees / Woody Vegetation					
Inspector Comments: Fig trees on landside slope					

Photo 1 of 1 : SP_2015_RD0765_211_40_20150309_00046.jpg



Looking southwest at fig trees and other trees on landside slope and toe.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide


Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	1.04	Rating **	M	Issue No.	58
LM End	1.04	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.488903 °	38.488903 °
				-121.554921 °	-121.554921 °
DWR ID	DWR_RD0765_01_f_2014_58				
Action/Comments					
Prunings					
Inspector Comments: Prunings on waterward shoulder.					

No Photos

LM Start	1.07	Rating **	A/W	Issue No.	37
LM End	1.07	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.488503 °	38.488503 °
				-121.554757 °	-121.554757 °
DWR ID	DWR_RD0765_01_s_2012_37				
Action/Comments					
Trim and thin trees to allow visibility of the ground and room to flood fight.					


Photo 1 of 4 : SP_2015_RD0765_211_37_20150309_00042.jpg

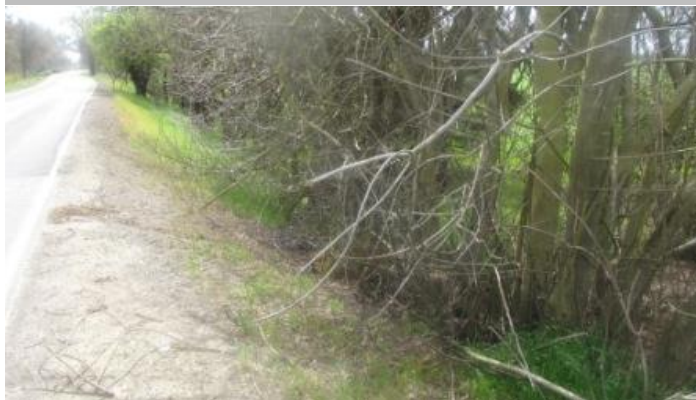

Looking downstream (south) at trees on landside slope & toe from 2010 fall inspection.

LM Start	1.07	Rating **	A/W	Issue No.	37 (cont)
LM End	1.07	Issue Type +	Ma	Location *	LS

Photo 2 of 4 : SP_2015_RD0765_211_37_20150309_00043.jpg

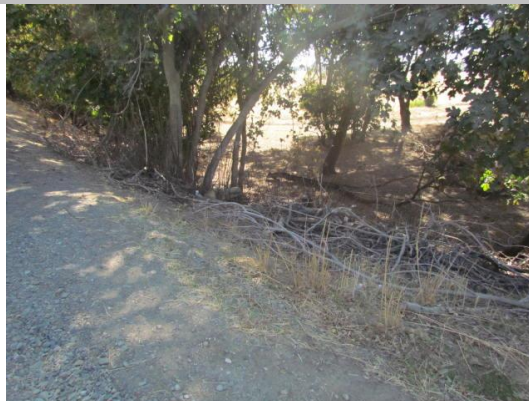

Looking southwest at trees on landward slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	1.07	Rating **	A/W	Issue No.	37 (cont)
LM End	1.07	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.488503 °	38.488503 °
				-121.554757 °	-121.554757 °
DWR ID	DWR_RD0765_01_s _ 2012_37				
Action/Comments					
Trim and thin trees to allow visibility of the ground and room to flood fight.					

Photo 3 of 4 : SP_2015_RD0765_211_37_20150309_00044.jpg



Looking downstream (southwest) at dense trees on landside slope and toe.

LM Start	1.07	Rating **	A/W	Issue No.	37 (cont)
LM End	1.07	Issue Type +	Ma	Location *	LS

Photo 4 of 4 : SP_2015_RD0765_211_37_20150309_00045.jpg



Looking west at trees on landside slope & toe.

LM Start	1.09	Rating **	M	Issue No.	38
LM End	1.15	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.488279 °	38.487465 °
				-121.554615 °	-121.554117 °
DWR ID	DWR_RD0765_01_s _ 2012_38				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	1.14	Rating **	A/W	Issue No.	48
LM End	1.14	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.487645 °	38.487645 °
				-121.554233 °	-121.554233 °
DWR ID	DWR_RD0765_01_f_2012_48				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Wild berryvines at landside toe.					

Photo 1 of 1 : SP_2015_RD0765_211_48_20150309_00049.jpg



Looking southwest at dense vegetation on landside slope and toe.

LM Start	1.15	Rating **	A/W	Issue No.	9
LM End	1.15	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.487473 °	38.487473 °
				-121.554080 °	-121.554080 °
DWR ID	DWR_RD0765_01_s_2012_9				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	1.29	Rating **	U	Issue No.	1
LM End	1.71	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.485623 °	38.480257 °
				-121.552987 °	-121.549458 °
DWR ID	DWR_RD0765_01_s_2012_1				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : SP_2015_RD0765_211_1_20150424_00071.jpg



Looking southeast at dense vegetation on waterward slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	1.29	Rating **	M	Issue No.	26
LM End	1.29	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.485561 °	38.485561 °
				-121.553031 °	-121.553031 °
DWR ID	DWR_RD0765_01_s _ 2012_26				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	1.32	Rating **	M	Issue No.	7
LM End	1.32	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.485287 °	38.485287 °
				-121.552818 °	-121.552818 °
DWR ID	DWR_RD0765_01_s _ 2015_7				
Action/Comments					
Tree or limb					
Inspector Comments: Down tree across waterward slope.					

Photo 1 of 1 : SP_2015_RD0765_211_7_20150424_00072.jpg



Looking north at down tree across waterward slope.

LM Start	1.39	Rating **	A/W	Issue No.	4
LM End	1.39	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.484316 °	38.484316 °
				-121.552115 °	-121.552115 °
DWR ID	DWR_RD0765_01_s _ 2012_4				
Action/Comments					
Trim trees to at least five feet above ground level.					

Photo 1 of 1 : SP_2015_RD0765_211_4_20150309_00004.jpg



Looking north at untrimmed trees on waterward slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	1.42	Rating **	A/W	Issue No.	5
LM End	1.45	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.483925 °	38.483530 °
				-121.551845 °	-121.551587 °
DWR ID	DWR_RD0765_01_s_2012_5				
Action/Comments					
Thin trees to allow visibility of the ground and room to flood fight.					

Photo 1 of 2 : SP_2015_RD0765_211_5_20150309_00005.jpg



Looking north at dense vegetation on waterside slope. (Fall Inspection 2012)

LM Start	1.42	Rating **	A/W	Issue No.	5 (cont)
LM End	1.45	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : SP_2015_RD0765_211_5_20150309_00006.jpg



Looking upstream (north) at dense trees on waterside slope.

LM Start	1.44	Rating **	A/W	Issue No.	41
LM End	1.44	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.483640 °	38.483640 °
				-121.551727 °	-121.551727 °
DWR ID	DWR_RD0765_01_s_2012_41				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	1.48	Rating **	A/W	Issue No.	42
LM End	1.50	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.483170 °	38.482965 °
				-121.551367 °	-121.551265 °
DWR ID	DWR_RD0765_01_s_2012_42				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	1.52	Rating **	M	Issue No.	29
LM End	1.62	Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.482665 °	38.481421 °
				-121.551036 °	-121.550207 °
DWR ID	DWR_RD0765_01_s_2012_29				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Dense berryvines and dense trees on landward slope. The LMA removed a sizeable amount of vines, but some still remain.					

Photo 1 of 6 : SP_2015_RD0765_211_29_20150309_00030.jpg

Looking south at dense vegetation on landside shoulder and slope.
(November 2011)

LM Start	1.52	Rating **	M	Issue No.	29 (cont)
LM End	1.62	Issue Type +	Ma	Location *	N/A

Photo 2 of 6 : SP_2015_RD0765_211_29_20150309_00031.jpg

Looking south at dense vegetation on landside slope and toe spring
2012.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	1.52	Rating **	M	Issue No.	29 (cont)
LM End	1.62	Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.482665 °	38.481421 °
				-121.551036 °	-121.550207 °
DWR ID	DWR_RD0765_01_s_2012_29				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Dense berryvines and dense trees on landward slope. The LMA removed a sizeable amount of vines, but some still remain.					

Photo 3 of 6 : SP_2015_RD0765_211_29_20150309_00032.jpg



Looking south at moderate vegetation on landward slope and toe. (Fall 2014)

Photo 4 of 6 : SP_2015_RD0765_211_29_20150309_00033.jpg



Looking southwest at vegetation on landside slope and toe. (Fall Inspection 2012)

Photo 5 of 6 : SP_2015_RD0765_211_29_20150309_00034.jpg



Looking southwest at berryvines on landside slope.

LM Start	1.52	Rating **	M	Issue No.	29 (cont)
LM End	1.62	Issue Type +	Ma	Location *	N/A

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	1.52	Rating **	M	Issue No.	29 (cont)
LM End	1.62	Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.482665 °	38.481421 °
				-121.551036 °	-121.550207 °
DWR ID	DWR_RD0765_01_s_2012_29				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Dense berryvines and dense trees on landward slope. The LMA removed a sizeable amount of vines, but some still remain.					

Photo 6 of 6 : SP_2015_RD0765_211_29_20150309_00035.jpg



Looking southwest at vegetation on landside slope.

LM Start	1.52	Rating **	M	Issue No.	30
LM End	1.52	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.482647 °	38.482647 °
				-121.550957 °	-121.550957 °
DWR ID	DWR_RD0765_01_s_2015_30				
Action/Comments					
Prunings Inspector Comments: Pruning piles on waterward berm.					

No Photos

LM Start	1.55	Rating **	U	Issue No.	57
LM End	1.55	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Bank Caving			38.482327 °	38.482327 °
				-121.550848 °	-121.550848 °
DWR ID	DWR_RD0765_01_s_2015_57				
Action/Comments					
Note and monitor erosion site.					
Inspector Comments: Caving greater than one inch deep and greater than three inches in length on landward shoulder.					

Photo 1 of 2 : SP_2015_RD0765_211_57_20150424_00073.jpg



Looking east at caving on landward shoulder.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	1.55	Rating **	U	Issue No.	57 (cont)	
LM End	1.55	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Erosion / Bank Caving			38.482327 °	38.482327 °	
				-121.550848 °	-121.550848 °	
DWR ID	DWR_RD0765_01_s_2015_57					
Action/Comments						
Note and monitor erosion site.						
Inspector Comments: Caving greater than one inch deep and greater that three inches in length on landward shoulder.						

Photo 2 of 2 : SP_2015_RD0765_211_57_20150424_00074.jpg



Looking south at caving on landward shoulder.

LM Start	1.66	Rating **	A/W	Issue No.	53
LM End	1.67	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.480892 °	°
				-121.549654 °	°
DWR ID	DWR_RD0765_01_s_2013_53				
Action/Comments					
Trim trees to at least five feet above ground level.					

Photo 1 of 2 : SP_2015_RD0765_211_53_20150309_00055.jpg



Looking north at trimmed trees on waterward slope. (Fall 2014)

LM Start	1.66	Rating **	A/W	Issue No.	53 (cont)
LM End	1.67	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : SP_2015_RD0765_211_53_20150309_00056.jpg



Looking north at dense vegetation on waterward slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	1.67	Rating **	M	Issue No.	13
LM End	1.68	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.480763 °	38.480632 °
				-121.549581 °	-121.549543 °
DWR ID	DWR_RD0765_01_s_2012_13				
Action/Comments					
Prunings					
Inspector Comments: LMA has removed some of the prunings.					

Photo 1 of 3 : SP_2015_RD0765_211_13_20150309_00016.jpg



Looking northeast at tree limbs on waterward slope.

Photo 2 of 3 : SP_2015_RD0765_211_13_20150309_00017.jpg



Looking east at large tree limb on waterward slope.

Photo 3 of 3 : SP_2015_RD0765_211_13_20150309_00018.jpg



Looking north at large tree limb on waterward slope.

LM Start	1.67	Rating **	M	Issue No.	13 (cont)
LM End	1.68	Issue Type +	Ma	Location *	WS

LM Start	1.67	Rating **	M	Issue No.	13 (cont)
LM End	1.68	Issue Type +	Ma	Location *	WS

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/23/2015 04/23/2015	Richard Willoughby

LM Start	1.69	Rating **	A/W	Issue No.	52
LM End	1.72	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.480519 °	38.480164 °
				-121.549513 °	-121.549445 °
DWR ID	DWR_RD0765_01_s _ 2013_52				
Action/Comments					
Trim trees to at least five feet above ground level.					


Photo 1 of 2 : SP_2015_RD0765_211_52_20150309_00053.jpg



Looking north (upstream) at trimmed trees on landward slope. (Fall 2014)

LM Start	1.69	Rating **	A/W	Issue No.	52 (cont)
LM End	1.72	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : SP_2015_RD0765_211_52_20150309_00054.jpg

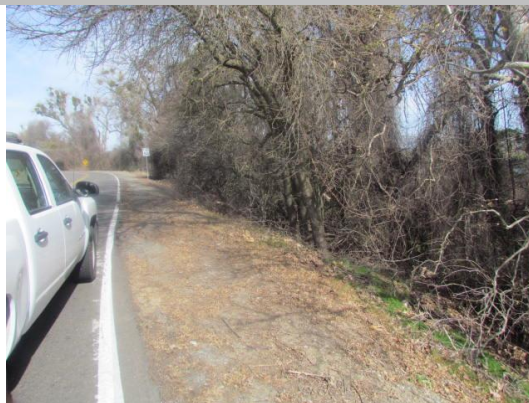

Looking north (upstream) at dense trees on landside slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--